


# 2SMPB-02E

Digital Barometric Pressure Sensor

## High accuracy and small size barometric pressure sensor with low current consumption

- Measure barometric pressure and temperature with high accuracy
- Built in low noise 24 bit ADC
- Digital control and output via I<sup>2</sup>C/SPI interface
- Automatically power down non-working circuit to minimize power consumption
- Individual calibration parameters stored in OTP\*

\* One Time Programmable - ROM

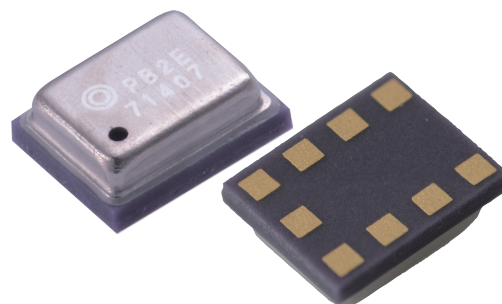

## Application Example

- Indoor navigation (floor detection)
- Car navigation (to distinguish highway and frontage road)
- Altimeter
- Activity monitor (to detect up and down of stairs)
- Life log
- Weather forecast

## Target Devices Example

- Smart Phones / Tablet PCs
- Wearable devices, such as watch type, band type, clip type or glasses type
- GPS devices
- Pedometer

## Packaging Information

### ■ Standard Models with Surface Mounting Terminals

Structure	Packaging	Model	Minimum Packing Unit
LGA 9 pin	Tape and Reel	2SMPB-02E	3,500

2SMPB-02E

## Table of Contents

Application Example .....	1
Target Devices Example .....	1
Packaging Information .....	1
■ Standard Models with Surface Mounting Terminals .....	1
Table of Contents .....	2
Ratings / Specifications / Function .....	3
■ Use conditions and recommended operating conditions .....	3
■ Absolute Maximum Ratings .....	3
■ Operating Ratings .....	3
■ Electrical Characteristics .....	3
■ Digital Interface Characteristics .....	3
■ Characteristics by Oversampling setting (Forced Mode) .....	4
■ rms Noise by IIR Filter Selection .....	4
■ Bandwidth by IIR Filter Selection .....	4
■ Filter selection based on use cases .....	4
Connection .....	5
■ Block Diagram .....	5
■ Pin Description and Layout .....	5
■ Typical Connection Diagram .....	6
Dimensions .....	7
■ Package .....	7
■ Outline Dimension .....	7
■ Mounting PAD Dimensions .....	7
■ Marking structure .....	7
Operations .....	8
■ Communication Mode .....	8
■ Power Mode .....	8
■ Compensation of Pressure and Temperature .....	9
■ Implementing Register List .....	11
■ I <sup>2</sup> C Protocol .....	14
■ SPI Protocol .....	15
■ Interface specifications .....	15
■ Reset Function .....	16
■ Recommended conditions of communication .....	16
Packaging .....	17
■ Configuration of shipment .....	17
■ Taping .....	17
■ Reel .....	18
■ Individual packaging .....	18
Recommended Soldering Method .....	19
■ Soldering method .....	19
■ Condition of Temperature .....	19
■ Recommended Soldering Method .....	19
Safety Precautions .....	20
Warranty and Limited Warranty .....	21

## Ratings / Specifications / Function

## ■ Use conditions and recommended operating conditions

Type of Pressure	Absolute pressure
Medium	Air *
Operating Pressure Range	30 kPa to 110 kPa

\* Never use corrosive gases.

## ■ Absolute Maximum Ratings

Item	Symbol	Rating	Unit	Remark
Power Supply Voltage	Vddmax	4.0	V	
Input Voltage (other than power)	Vmax	-0.2 to Vopr+0.2	V	
Maximum Pressure	Pmax	800	kPa	
Storage Temperature	Tstr	-40 to 85	°C	with no condensation or icing
Storage Humidity	Hstr	10 to 95	%RH	with no condensation or icing
ESD (HBM)	Vhbm	±2000	V	
ESD (MM)	Vmm	±200	V	
ESD (CDM)	Vcdm	±500	V	

## ■ Operating Ratings

Item	Symbol	Min.	Typ.	Max.	Unit	Remark
Operating Voltage	Vopr	1.71	1.8	3.6	V	VDD
	Vio	1.20	1.8	3.6	V	VDDIO
Operating Temperature	Topr	-40	-	85	°C	

## ■ Electrical Characteristics (At Ta = 25°C, VDD = 1.8 V, unless otherwise noted)

Item	Symbol	Condition	Min.	Typ.	Max.	Unit
Average Current	Ihp	1 sample/s Forced Mode Ultra High Accuracy	-	21.4	-	μA
Operating Current Consumption	Iddp	Pressure mode	-	640	800	μA
	Iddt	Temperature mode	-	410	520	μA
Sleep Mode Current Consumption	Isleep		-	1.1	2.3	μA
Measureable Pressure Range	Popr		30	-	110	kPa
Absolute Pressure Accuracy	Pabs1	30 to 110 kPa, 0 to 65°C	-	±50	-	Pa
	Pabs2	30 to 110 kPa, -20 to 0°C	-	±80	-	
Relative Pressure Accuracy	Prel1	Ultra High Accuracy	-	±3.9	-	Pa
rms Noise	Pnois	Ultra High Accuracy	-	1.3	-	Pa
Absolute Temperature Accuracy	Tab5	30 to 110 kPa, -20 to 65°C	-2	-	2	°C
Pressure Resolution	Pres		-	0.06	-	Pa
Temperature Resolution	Tres		-	0.0002	-	°C
Power Supply Rejection Ratio (DC)	Ppsrr	101.3 kPa, 0 to 40°C, 1.71 to 3.6 V Base on VDD = 1.8 V	-9.4	-	9.4	Pa

Note: 1. Typical specifications are not guaranteed.

Note: 2. The above table shows the characteristics of the Package before soldering.

## ■ Digital Interface Characteristics (At Ta = 25°C, VDD = 1.8 V, unless otherwise noted)

Item	Symbol	Condition	Min.	Typ.	Max.	Unit
Digital Input Low Voltage	Vil_d		-	-	Vio×0.2	V
Digital Input High Voltage	Vih_d		Vio×0.8	-	Vio+0.2	V
Digital Input Hysteresis Voltage	Vidhys		Vio×0.1	-	-	V
Digital Output Low Voltage (I <sup>2</sup> C)	Vol_d1	Io = 3 mA (SDI) *	0	-	Vio×0.2	V
Digital Output Low Voltage (SPI)	Vol_d2	Io = 1 mA (SDI, SDO) *	0	-	Vio×0.2	V
Digital Output High Voltage1 (SPI) (Vio ≥ 1.62 V)	Voh_d1	Io = 1 mA (SDI, SDO) *	Vio×0.8	-	-	V
Digital Output High Voltage2 (SPI) (Vio ≥ 1.2 V)	Voh_d2	Io = 1 mA (SDI, SDO) *	Vio×0.6	-	-	V
Leakage Current at Output OFF	Ioff	SDI, SDO	-10	-	10	μA
Internal Pullup Resistor	Rpullup	CSB	70	120	190	kΩ
I <sup>2</sup> C Load Capacitance	Cb	SDI, SCK	-	-	400	pF
Load Capacitance of Reset Terminal	Crst		-	-	20	pF
Pulse Width of Asynchronous Reset	Trst		100	-	-	μsec
Power On Startup Time	Tstart		-	-	10	msec

\* "Io" is the load current of the output terminal.

Note: Undescribed items are compliant with the I<sup>2</sup>C specification.

About detailed I<sup>2</sup>C bus information, please refer to the I<sup>2</sup>C bus specification and user manual presented by NXP.

## ■ Characteristics by Oversampling setting (Forced Mode)

(At Ta = 25°C, VDD = 1.8 V, CPU Clock Frequency = 300 kHz, unless otherwise noted)

Oversampling setting	Pressure oversampling	Temperature oversampling	Measurement time Typ.	ODR @ standby 1 ms Typ.	Average Current Typ. @ 1 sample/sec Forced Mode	rms Noise Typ.
unit	-	-	msec	Hz	μA	Pa
High speed	2	1	5.5	153	4.1	5.2
Low power	4	1	7.2	121	5.2	3.7
Standard	8	1	10.6	86	7.3	2.6
High accuracy	16	2	18.3	51	12.0	1.8
Ultra High accuracy	32	4	33.7	28	21.4	1.3

Note 1: These characteristics are guaranteed by design.

Note 2: ODR is defined as Output data rate at standby time 1 msec.

## ■ rms Noise by IIR Filter Selection (At Ta = 25°C, VDD = 1.8 V, unless otherwise noted)

Oversampling setting	Typical rms Noise in Pressure [Pa]					
	IIR filter coefficient					
	off	2	4	8	16	32
High speed	5.2	2.5	1.6	1.1	0.8	0.5
Low power	3.7	1.8	1.1	0.8	0.5	0.4
Standard	2.6	1.3	0.8	0.5	0.4	0.3
High accuracy	1.8	0.9	0.6	0.4	0.3	0.3
Ultra High accuracy	1.3	0.6	0.4	0.3	0.3	0.2

Note 1: IIR; Infinite impulse response

Note 2: These characteristics are guaranteed by design.

Note 3: Initial setting of the IIR filter coefficient is "off".

## ■ Bandwidth by IIR Filter Selection (At Ta = 25°C, VDD = 1.8 V, unless otherwise noted)

Oversampling setting	Typical Bandwidth [Hz]					
	IIR filter coefficient					
	off	2	4	8	16	32
High speed	153.0	35.3	14.7	6.8	3.3	1.6
Low power	121.0	28.0	11.6	5.4	2.6	1.3
Standard	86.0	19.9	8.3	3.8	1.8	0.9
High accuracy	51.0	11.8	4.9	2.3	1.1	0.5
Ultra High accuracy	28.0	6.5	2.7	1.2	0.6	0.3

Note 1: These characteristics are guaranteed by design.

Note 2: Initial setting of the IIR filter coefficient is "off".


## ■ Filter selection based on use cases (At Ta = 25°C, VDD = 1.8 V, unless otherwise noted)

Example use case	Oversampling setting	Pressure over sampling times	Temp. over sampling times	Specification (Typ.)			
				IIR filter coefficient	Current consumption [μA]	ODR [Hz] (Example)	rms Noise [Pa]
Weather monitoring	High speed	×2	×1	off	1.2	0.05	5.2
Drop detection	Low power	×4	×1	off	407	100	3.7
Elevator detection	Standard	×8	×1	4	63.4	10	0.8
Stair detection	High accuracy	×16	×2	8	219	20	0.4
Indoor navigation	Ultra high accuracy	×32	×4	32	570	28	0.2


Note: These characteristics are guaranteed by design.

Connection

■ Block Diagram

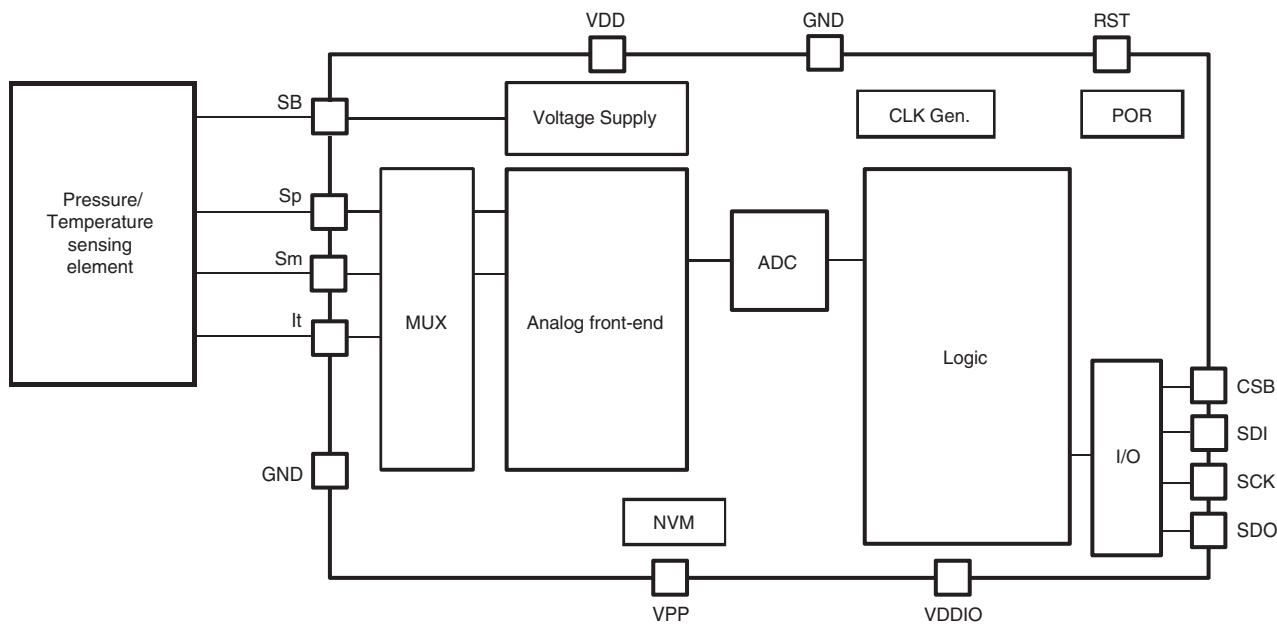

■ Pin Description and Layout

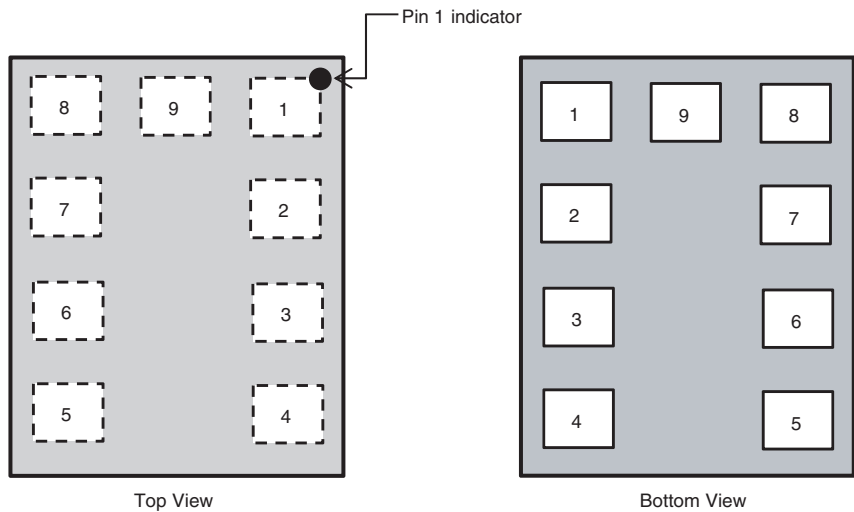


Pin No.	Symbol	Description	
		SPI	I <sup>2</sup> C
1	RST	Asynchronous Reset *1	
2	CSB	CSB	VDDIO
3	SDI	SDI/SDO	SDA
4	SCK	SCK	SCL
5	SDO	SDO	ADDR
6	VDDIO	Power Terminal for Digital IO	
7	GND	Ground Terminal	
8	VDD	Power Terminal	
9	VPP	NVM Writing Terminal *2	


\*1. If you do not need the reset function, please just have the layout design of PCB of connecting both No. 1 (RST) pin and No. 7 (GND) pin into the ground of PCB. Please refer "■Reset Function" for the case of using the reset function.  
\*2. Pin 9 is only used internally in OMRON. Please leave the pin disconnected.  
If Pin 9 is connected with any other Pin electrically, the sensor will not work properly.

■ Typical Connection Diagram


I<sup>2</sup>C mode (Corresponding to 100 Kbit/s (at Standard Mode), 400 Kbit/s (at Fast Mode) and 3.4 Mbit/s (at High Speed Mode))

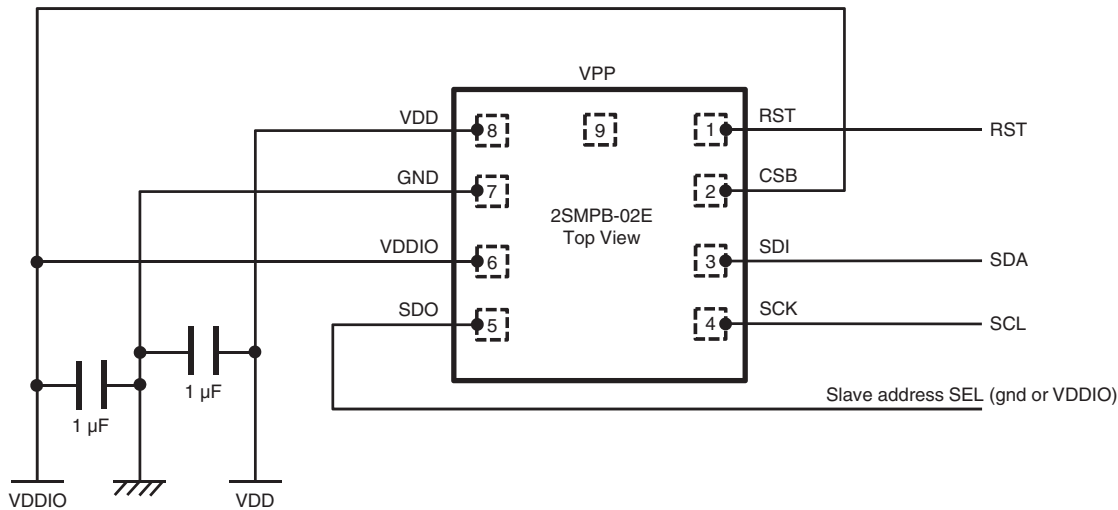

4-wire SPI mode (Corresponding to 10 Mbit/s)

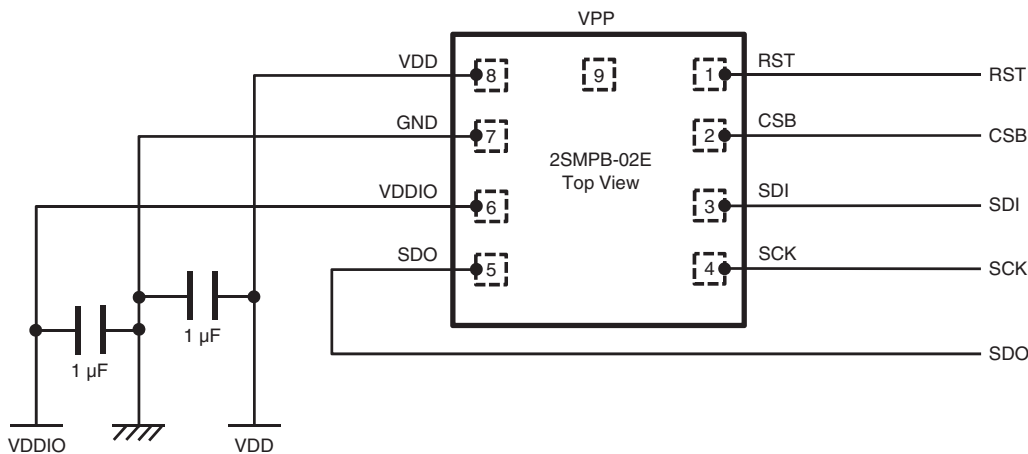

3-wire SPI mode (Corresponding to 10 Mbit/s)

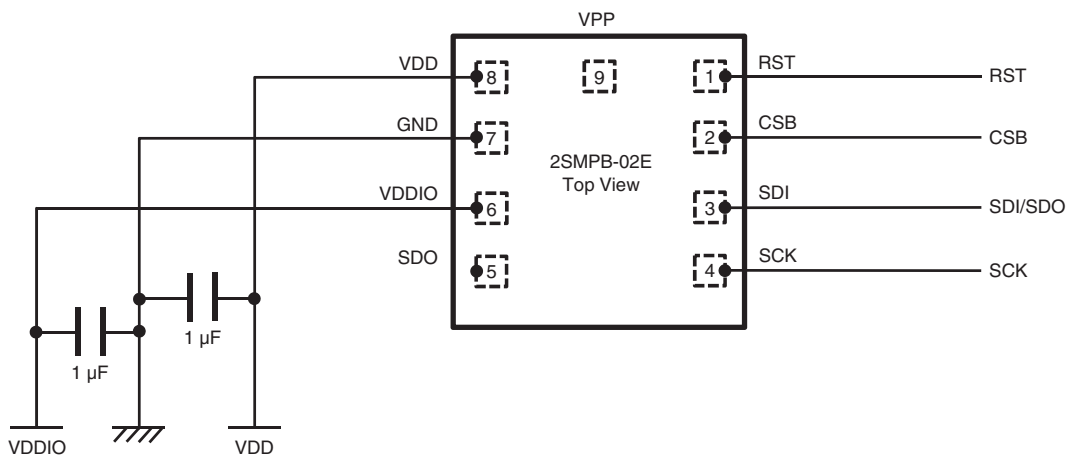


Dimensions (Unit: mm)


Package

Package Type: LGA (Land Grid Array) 9 pin  
Package Size: 2.00 × 2.50 × 0.85 mm  
Material of the terminal surface: Au


Outline Dimension

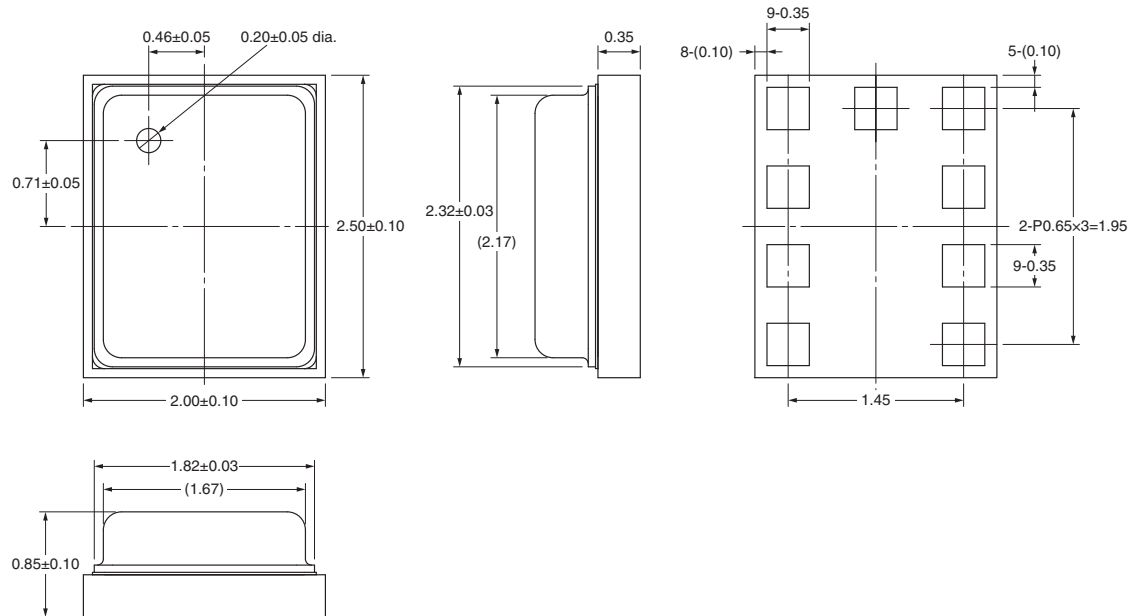

Mounting PAD Dimensions  
Recommended (Top View)

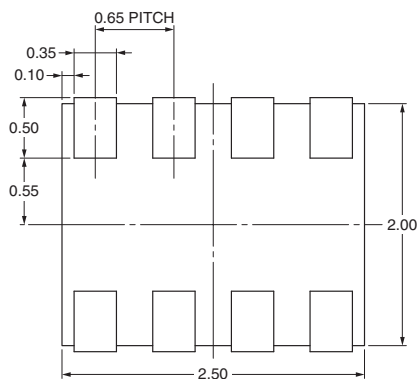

Marking structure

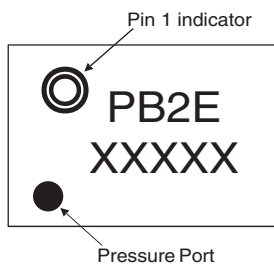

## Operations

### ■ Communication Mode

This sensor is corresponding to I<sup>2</sup>C and SPI communication.

Digital interface terminal functions for each communication mode are as below.

Communication Mode	CSB	SDI	SCK	SDO	Remark
I <sup>2</sup> C	VDDIO	SDA	SCL	GND/VDDIO	SDO = GND → 70h, SDO = VDDIO → 56h
SPI 3 Wires	CSB	SDI/O	SCK	-	spi3w Register = 1
SPI 4 Wires	CSB	SDI	SCK	SDO	spi3w Register = 0

When changing the communication mode, also see Typical Connection Diagram section.

- I<sup>2</sup>C mode becomes effective by pulling CSB up to VDDIO.
- SPI mode becomes effective by pulling CSB down to GND.
- Once CSB is pulled down, SPI mode would not be changed unless otherwise Power on Reset (POR) or Asynchronous Reset. Switching between SPI 3-Wire mode and SPI 4-Wire mode can be configured with the register value of “spi3w”. Refer to IO\_SETUP register section for more detail.
- Default mode after POR or Asynchronous Reset will be I<sup>2</sup>C mode.


### ■ Power Mode

This sensor has three power modes and it can be switched by setting CTRL\_MEAS register.

Refer to the “CTRL\_MEAS” register section for more detail.

- Sleep Mode
- Normal Mode
- Forced Mode

Transition diagram for each mode is as follows.

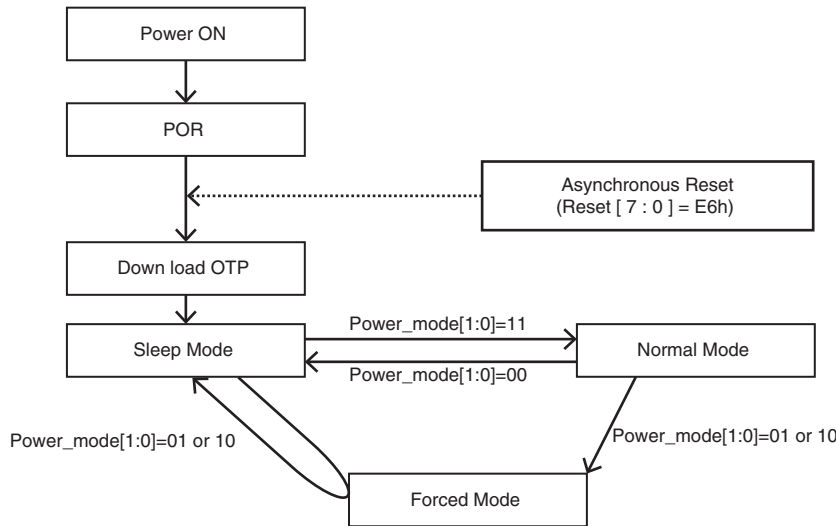


### Sleep Mode (Power Reduction Mode)

No measurements are performed.

I<sup>2</sup>C/SPI interface and each register can be accessed even if the sensor is in Sleep Mode.


### Forced Mode

In case of Forced Mode, a single measurement is performed. When the set up measurement is finished, the sensor returns to Sleep Mode after storing the measurement data to the register.



### Normal Mode


In case of Normal Mode, the measurements are performed repeatedly between a measurement period and a standby period. The standby time can be configured by “t\_stanby[2:0]” register. Be sure to consider that the data must be read from the master side after a Normal Mode.





### ■ Compensation of Pressure and Temperature

This section describes a typical measurement procedure and a calculation method after POR. This sensor has compensation coefficients in internal Non Volatile Memory (NVM). The compensated pressure can be calculated by using these values.

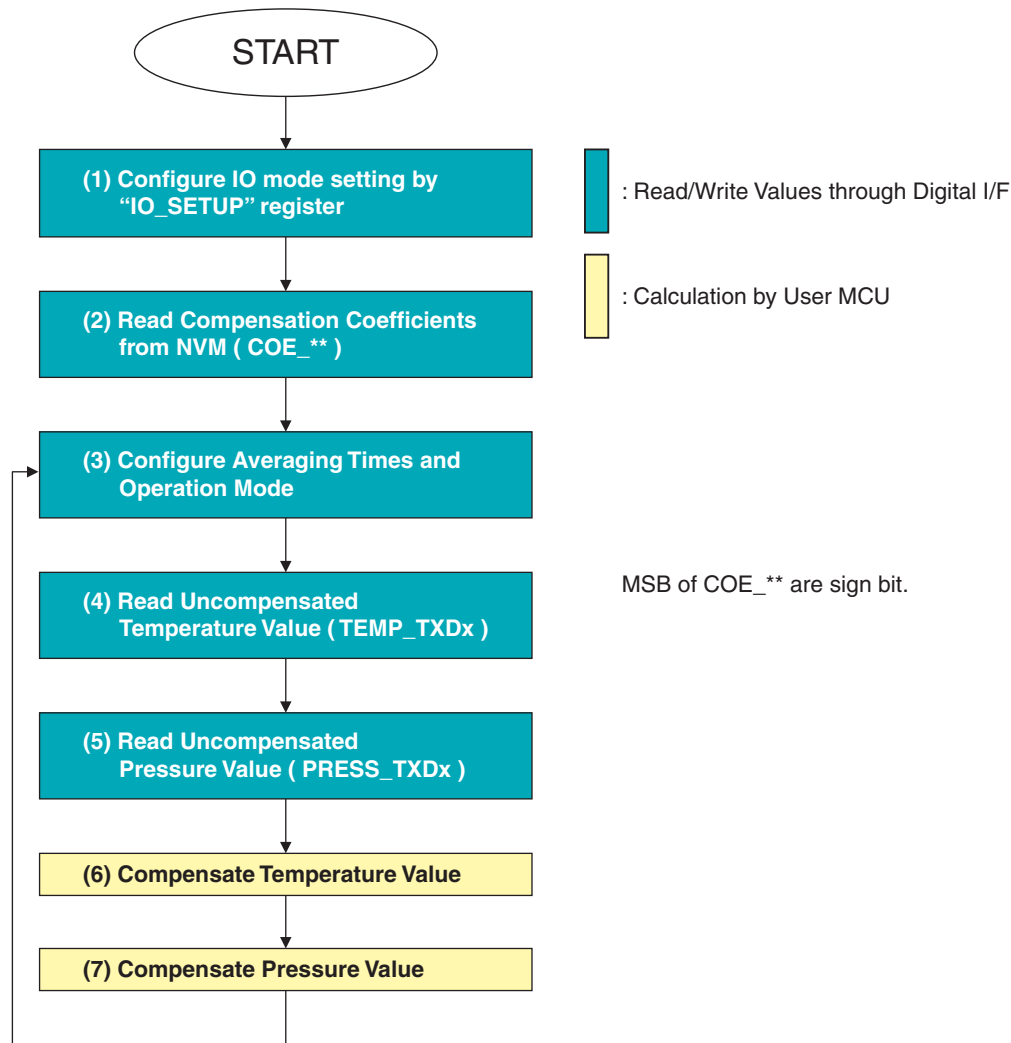

- (1) Configure IO mode setting. Refer to IO\_SETUP register section for more detail.
- (2) Read compensation coefficients which are stored in NVM. This procedure is sufficient just once after POR. These values are used for a compensation calculation at the step (6) and (7).
- (3) Configure averaging times and operation mode. Refer to CTRL\_MEAS register section for more detail.
- (4) Read raw temperature data which are stored in TEMP\_TXDx registers.
- (5) Read raw pressure data which are stored in PRESS\_TXDx registers.
- (6) Compensated temperature can be calculated by using the below formula and the values of the step (2) and (4).

$$Tr = a0 + a1 \cdot Dt + a2 \cdot Dt^2$$

$Tr$ : Calculation Result of Temperature (  $Tr/256$  = Temperature [degree C] )

e.g.) If  $Tr$  Value is 6400 LSB,

$$\text{Temperature (degree C)} = \frac{\text{Tr Value (LSB)}}{\text{Scaling Factor}} = \frac{6400 \text{ LSB}}{256 \text{ LSB/degree C}} = 25.00 \text{ degree C}$$

$Dt$ : Raw Temperature Data [digit] ( 20-24bits measurement value of TEMP\_TXDx Reg. )

$a0$ : Compensation Coefficient of PTAT (NVM resistor: COE\_a0\_ex, COE\_a0\_0, COE\_a0\_1 )

$a1$ : Compensation Coefficient of PTAT (NVM resistor: COE\_a1\_0, COE\_a1\_1 )

$a2$ : Compensation Coefficient of PTAT (NVM resistor: COE\_a2\_0, COE\_a2\_1 )

- (7) Correction pressure without temperature compensation can be calculated by using the below formula and the values of the step (2) and (6).

$$Pr = b00 + bt1 \cdot Tr + bp1 \cdot Dp + b11 \cdot Dp \cdot Tr + bt2 \cdot Tr^2 + bp2 \cdot Dp^2 + b12 \cdot Dp \cdot Tr^2 + b21 \cdot Dp^2 \cdot Tr + bp3 \cdot Dp^3$$

*Pr*: Calculation Result of Pressure [Pa]

*Tr*: Calculation Result of Temperature (  $Tr/256$  = Temperature [degreeC] )

*Dp*: Raw Pressure Data [digit] ( 20-24bits measurement value of PRESS\_TXDx Reg. )

*b00*: Compensation Coefficient of Pressure ( NVM resister: COE\_b00\_ex, COE\_b00\_0, COE\_b00\_1 )

*bt1*: Compensation Coefficient of Pressure ( NVM resister: COE\_bt1\_0, COE\_bt1\_1 )

*bp1*: Compensation Coefficient of Pressure ( NVM resister: COE\_bp1\_0, COE\_bp1\_1 )

*b11*: Compensation Coefficient of Pressure ( NVM resister: COE\_b11\_0, COE\_b11\_1 )

*bt2*: Compensation Coefficient of Pressure ( NVM resister: COE\_bt2\_0, COE\_bt2\_1 )

*bp2*: Compensation Coefficient of Pressure ( NVM resister: COE\_bp2\_0, COE\_bp2\_1 )

*b12*: Compensation Coefficient of Pressure ( NVM resister: COE\_b12\_0, COE\_b12\_1 )

*b21*: Compensation Coefficient of Pressure ( NVM resister: COE\_b21\_0, COE\_b21\_1 )

*bp3*: Compensation Coefficient of Pressure ( NVM resister: COE\_bp3\_0, COE\_bp3\_1 )

### How to get compensation coefficients

Each compensation coefficients can be calculated by using the below formula and conversion factors.

$$K = A + \frac{S \times OTP}{32767} \dots\dots a1, a2, bt1, bt2, bp1, b11, bp2, b12, b21, bp3 \quad K = \frac{OTP}{16} \dots\dots a0, b00$$

K	Conversion factor		OTP		
	A	S	23-16 bit	15-8 bit	7-0 bit
a1	-6.3E-03	4.3E-04	-	COE_a1_1	COE_a1_0
a2	-1.9E-11	1.2E-10	-	COE_a2_1	COE_a2_0
bt1	1.0E-01	9.1E-02	-	COE_bt1_1	COE_bt1_0
bt2	1.2E-08	1.2E-06	-	COE_bt2_1	COE_bt2_0
bp1	3.3E-02	1.9E-02	-	COE_bp1_1	COE_bp1_0
b11	2.1E-07	1.4E-07	-	COE_b11_1	COE_b11_0
bp2	-6.3E-10	3.5E-10	-	COE_bp2_1	COE_bp2_0
b12	2.9E-13	7.6E-13	-	COE_b12_1	COE_b12_0
b21	2.1E-15	1.2E-14	-	COE_b21_1	COE_b21_0
bp3	1.3E-16	7.9E-17	-	COE_bp3_1	COE_bp3_0

K	Conversion factor	OTP		
		19-12 bit	11-4 bit	3-0 bit
a0	Offset value (20Q16)	COE_a0_1	COE_a0_0	COE_a0_ex
b00	Offset value (20Q16)	COE_b00_1	COE_b00_0	COE_b00_ex

## ■ Implementing Register List

Register Name	Address		Length	R/W	Data								Descriptions	Initial
	I <sup>2</sup> C	SPI			bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0		
TEMP_TXD0	FCh	7Ch	8bit	R/-	t_tx0[7:0]								Temperature DATA [8:1] in 24 bits	00h
TEMP_TXD1	FBh	7Bh	8bit	R/-	t_tx1[7:0]								Temperature DATA [16:9] in 24 bits	00h
TEMP_TXD2	FAh	7Ah	8bit	R/-	t_tx2[7:0]								Temperature DATA [24:17] in 24 bits *	00h
PRESS_TXD0	F9h	79h	8bit	R/-	p_tx0[7:0]								Pressure DATA [8:1] in 24 bits	00h
PRESS_TXD1	F8h	78h	8bit	R/-	p_tx1[7:0]								Pressure DATA [16:9] in 24 bits	00h
PRESS_TXD2	F7h	77h	8bit	R/-	p_tx2[7:0]								Pressure DATA [24:17] in 24 bits *	00h
IO_SETUP	F5h	75h	8bit	R/W	t_stanby[2:0]		-		spi3_sdim		-	spi3w	t_stanby[2:0] : Standby time setting spi3w : SPI mode setting (4 or 3 wire) spi3_sdim : Select output type of SDI terminal	00h
CTRL_MEAS	F4h	74h	8bit	R/W	temp_average[2:0]		press_average[2:0]			power_mode[1:0]			temp_average[2:0] : Temperature Averaging Times press_average[2:0] : Pressure Averaging Times power_mode[1:0] : Power mode setting	00h
DEVICE_STAT	F3h	73h	8bit	R/-	-	-	-	-	measure	-	-	otp_update	measure : Status of measurement otp_update : Status of OTP data access	00h
I <sup>2</sup> C_SET	F2h	72h	8bit	R/W	-	-	-	-	-	master_code[2:0]			Master code setting at I <sup>2</sup> C HS mode	01h
IIR_CNT	F1h	71h	8bit	R/W	-	-	-	-	-	filter[2:0]			IIR filter co-efficient setting	00h
RESET	E0h	60h	8bit	W	reset[7:0]								When inputting "E6h", a software reset will be occurred.	00h
CHIP_ID	D1h	51h	8bit	R/-	chip_id[7:0]								CHIP_ID : 5Ch	5Ch
COE_b00_a0_ex	B8h	38h	8bit	R/-	b00[3:0]			a0[3:0]					Compensation Coefficient	-
COE_a2_0	B7h	37h	8bit	R/-	a2[7:0]								Compensation Coefficient	-
COE_a2_1	B6h	36h	8bit	R/-	a2[15:8]								Compensation Coefficient *	-
COE_a1_0	B5h	35h	8bit	R/-	a1[7:0]								Compensation Coefficient	-
COE_a1_1	B4h	34h	8bit	R/-	a1[15:8]								Compensation Coefficient *	-
COE_a0_0	B3h	33h	8bit	R/-	a0[11:4]								Compensation Coefficient	-
COE_a0_1	B2h	32h	8bit	R/-	a0[19:12]								Compensation Coefficient *	-
COE_bp3_0	B1h	31h	8bit	R/-	bp3[7:0]								Compensation Coefficient	-
COE_bp3_1	B0h	30h	8bit	R/-	bp3[15:8]								Compensation Coefficient *	-
COE_b21_0	AFh	2Fh	8bit	R/-	b21[7:0]								Compensation Coefficient	-
COE_b21_1	AEh	2Eh	8bit	R/-	b21[15:8]								Compensation Coefficient *	-
COE_b12_0	ADh	2Dh	8bit	R/-	b12[7:0]								Compensation Coefficient	-
COE_b12_1	ACH	2Ch	8bit	R/-	b12[15:8]								Compensation Coefficient *	-
COE_bp2_0	ABh	2Bh	8bit	R/-	bp2[7:0]								Compensation Coefficient	-
COE_bp2_1	AAh	2Ah	8bit	R/-	bp2[15:8]								Compensation Coefficient *	-
COE_b11_0	A9h	29h	8bit	R/-	b11[7:0]								Compensation Coefficient	-
COE_b11_1	A8h	28h	8bit	R/-	b11[15:8]								Compensation Coefficient *	-
COE_bp1_0	A7h	27h	8bit	R/-	bp1[7:0]								Compensation Coefficient	-
COE_bp1_1	A6h	26h	8bit	R/-	bp1[15:8]								Compensation Coefficient *	-
COE_bt2_0	A5h	25h	8bit	R/-	bt2[7:0]								Compensation Coefficient	-
COE_bt2_1	A4h	24h	8bit	R/-	bt2[15:8]								Compensation Coefficient *	-
COE_bt1_0	A3h	23h	8bit	R/-	bt1[7:0]								Compensation Coefficient	-
COE_bt1_1	A2h	22h	8bit	R/-	bt1[15:8]								Compensation Coefficient *	-
COE_b00_0	A1h	21h	8bit	R/-	b00[11:4]								Compensation Coefficient	-
COE_b00_1	A0h	20h	8bit	R/-	b00[19:12]								Compensation Coefficient *	-

\* MSB of PRESS\_TXDx, TEMP\_TXDx and COE\_\*\* are sign bit.

**TEMP(PRESS)\_TXDx : Temperature and Pressure data : TXD0, TXD1 or TXD2**

This sensor holds ADC data with 22 to 24 bits accuracy. It can be obtained as each 24 bits data. If there are redundant data, the low order positions will be filled by zero (0). The shaded regions as shown below are valid data area.

bit	24	23	22	...	5	4	3	2	1	Note
22 bits output	D21	D20	D19	...	D2	D1	D0	0	0	Temp/Press_ave = 001
23 bits output	D22	D21	D20	...	D3	D2	D1	D0	0	Temp/Press_ave = 010
24 bits output	D23	D22	D21	...	D4	D3	D2	D1	D0	Temp/Press_ave = 011 to 111

Note: 1. Dn (D23 to D0) : Sensor Data .....The value of n bit (1 or 0)

Note: 2. The raw measurement values are unsigned 24 bits values. The values need to do subtraction with  $2^{23}$  at 24 bits output mode. Here is a programming example for Dt and Dp calculation.

$$Dt = ((TEMP\_TXD2) \ll 16) + ((TEMP\_TXD1) \ll 8) + (TEMP\_TXD0) - pow(2,23)$$

$$Dp = ((PRESS\_TXD2) \ll 16) + ((PRESS\_TXD1) \ll 8) + (PRESS\_TXD0) - pow(2,23)$$

**IO\_SETUP : IO SETUP Register**

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
IO_SETUP	F5h	75h	8bits	R/W	t_stanby[2:0]			—	—	spi3_sdim	—	spi3w	00h

bit7 to 5 t\_stanby[2:0] : Standby time setting

000	001	010	011	100	101	110	111
1 ms	5 ms	50 ms	250 ms	500 ms	1 s	2 s	4 s

bit3 to 4 Reserved : keep these bits at 0

bit2 spi3\_sdim : Select output type of SDI terminal

0 : Lo / Hi-z output (Default)

1 : Lo / Hi output

bit1 Reserved : keep this bit at 0

bit0 spi3w : Change mode between SPI 4-wire and SPI 3-wire

0 : 4-wire (Default)

1 : 3-wire

**CTRL\_MEAS : Measurement Condition Control Register**

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
CTRL_MEAS	F4h	74h	8bits	R/W	temp_average[2:0]			press_average[2:0]			power_mode[1:0]		00h

bit7 to 5 temp\_average[2:0] Averaging times setting for Temperature measurement (skip means no measurement.)

000	001	010	011	100	101	110	111
skip	1	2	4	8	16	32	64

bit4 to 2 press\_average[2:0] Averaging times setting for Pressure measurement (skip means no measurement.)

000	001	010	011	100	101	110	111
skip	1	2	4	8	16	32	64

bit1, 0 power\_mode[1:0] Operation mode setting

00 : Sleep Mode

01, 10 : Forced Mode

11 : Normal Mode

**DEVICE\_STAT : Device Status Register**

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
DEVICE_STAT	F3h	73h	8bits	R	—	—	—	—	measure	—	—	otp_update	00h

bit7 to 4 Reserved : keep these bits at 0

bit3 measure Device operation status. This value automatically changes.

0: Finish a measurement -- waiting for next measurement

1: On a measurement -- waiting for finishing the data store

bit2, 1 Reserved : keep these bits at 0

bit0 otp\_update The status of NVM data access. This value automatically changes.

0: No accessing NVM data

1: While accessing NVM data

I<sup>2</sup>C\_SET : Master code setting

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
I <sup>2</sup> C_SET	F2h	72h	8bits	R/W	—	—	—	—	—	master_code[2:0]			01h

bit7 to 3    Reserved : keep these bits at 0  
bit2, 1, 0    master\_code[2:0]    Master code setting at I<sup>2</sup>C high-speed mode.


000	001	010	011	100	101	110	111
08h	09h	0Ah	0Bh	0Ch	0Dh	0Eh	0Fh

IIR\_CNT : IIR filter co-efficient setting Register

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
IIR_CNT	F1h	71h	8bits	R/W	—	—	—	—	—	filter[2:0]			00h

bit7 to 3    Reserved : keep these bits at 0  
bit2, 1, 0    filter[2:0]    IIR filter co-efficient setting  
Write access to this register address, IIR filter will be initialized.

Note: Initial setting of the IIR filter coefficient is "off".

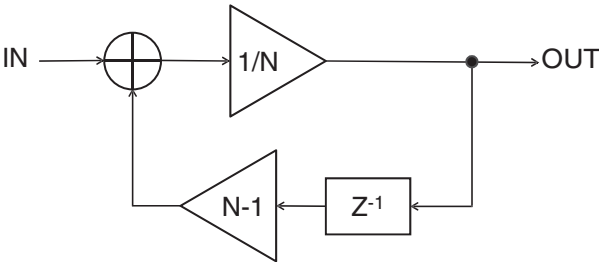

000	001	010	011	100	101	110	111
OFF	N = 2	N = 4	N = 8	N = 16	N = 32	N = 32	N = 32

RESET : Reset Control Register

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
RESET	E0h	60h	8bits	W	reset[7:0]								00h

bit7 to 0    reset[7:0]    When input "E6h", the software reset will be effective.  
Except for that, nothing is to happen.

CHIP\_ID : Chip ID Confirmation Register

Register Name	I <sup>2</sup> C Addr.	SPI Addr.	Length	R/W	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0	initial
CHIP_ID	D1h	51h	8bits	R	chip_id[7:0]								5Ch

bit7 to 0    chip\_id[7:0]    5Ch

## ■ I<sup>2</sup>C Protocol

### (1) I<sup>2</sup>C Slave Address

The 2SMPB-02 module I<sup>2</sup>C slave address is shown below.

SDO	I <sup>2</sup> C Slave Address (7 bits)	Bit	bit7	bit6	bit5	bit4	bit3	bit2	bit1	bit0
			Add[6]	Add[5]	Add[4]	Add[3]	Add[2]	Add[1]	Add[0]	R/W
High (1)	56h + R/W	Value	1	0	1	0	1	1	0	1/0
Low (0)	70h + R/W	Value	1	1	1	0	0	0	0	1/0

For example, in case of SDO = Low (0),

Write Access : Please set LSB of slave address as "0", then the address is E0h (1110\_0000b). (70h<<1+WR(0))


Read Access : Please set LSB of slave address as "1", then the address is E1h (1110\_0001b). (70h<<1+RD(1))

### (2) I<sup>2</sup>C Access Protocol Examples

Symbol	Condition
START	START condition
STOP	STOP condition
SACK	Acknowledge by Slave
MACK	Acknowledge by Master
MNACK	Not Acknowledge by Master


### (3) Register Write Access Protocol

After the START condition, a Device Address is sent. This address is seven bits long followed by an eighth bit which is a data direction bit. A 'zero' indicates a transmission "WRITE". After that, the register address and the writing data shall be one set and it should be continuously transmitted until a STOP condition. A data transfer is always terminated by a STOP condition generated by the master.

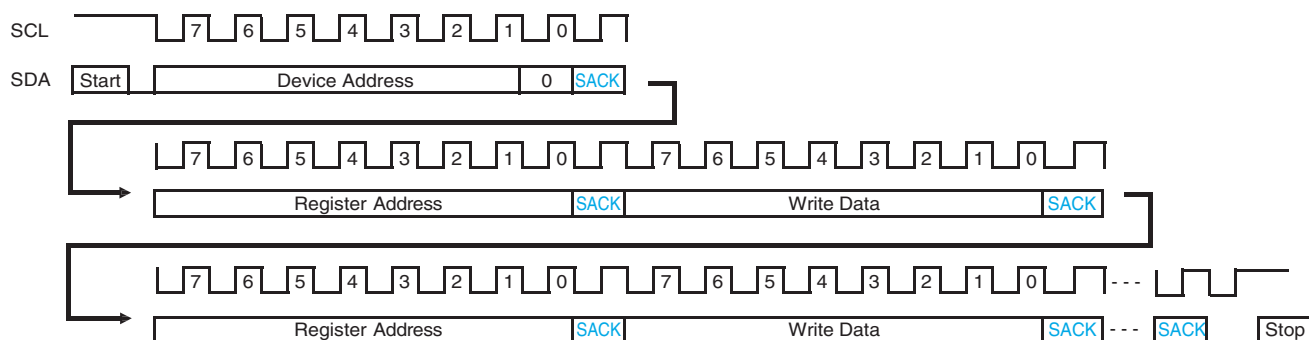

### (4) Register Read Access Protocol


After a START condition, the Device Address with WRITE sign ("0") and Word Address intended to read a first data are transmitted. Next, "STOP-START" or "Re-START" condition is transmitted by the master. After that, Device Address with READ sign ("1") is transmitted by the master. Then, the slave will output the first data that is intended to read. In case of incrementing Register Address automatically, the slave will output the data repeatedly until NACK is input by the master. If Register Address becomes "FFh", please continue to output "00h". Below example shows 3 bytes reading method from "FAh" register.

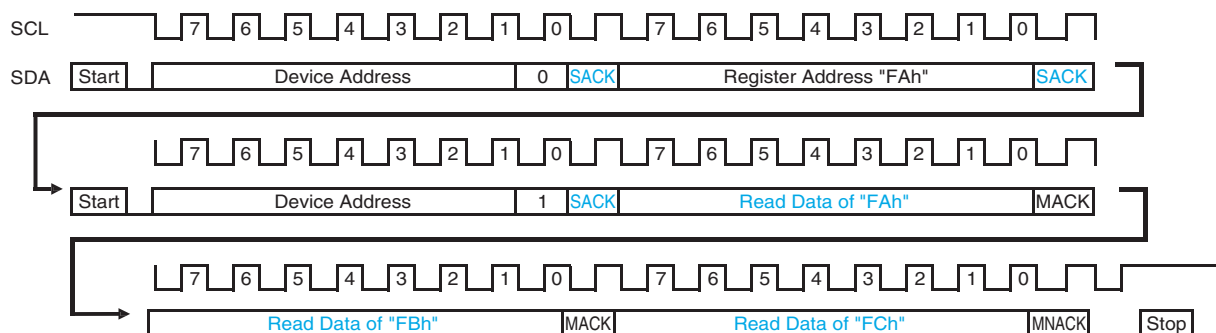

## ■ SPI Protocol

### (1) SPI write

"SPI Write" needs to transmit the one set data of Register Address (Ctl.="0"+Address) and a writing data in the situation where CSB is "L". Two or more writing can be possible during CSB is "L". If CSB becomes "H", SPI communication will finish. (as well as I<sup>2</sup>C write)

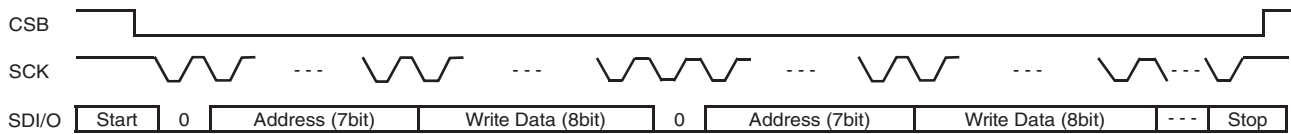


### (2) SPI read

First, "SPI read" needs to transmit Register Address (Ctl.="1"+Address) in a situation where CSB is "L".

Next, the data of the requested register address will be output from SDO. (in case of 3-wire mode, the data will be output from SDI). After that, the register address is automatically incremented by one until CSB becomes "H", the device will output the data repeatedly. (as well as I<sup>2</sup>C read)

Below shows an example of the 2 bytes reading from "FAh" register.

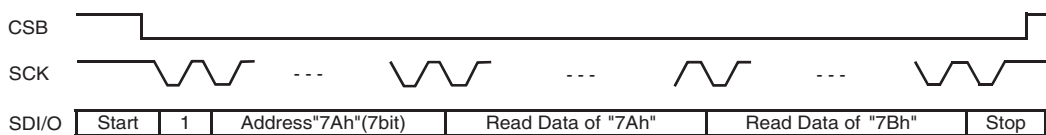

## ■ Interface specifications

### (1) I<sup>2</sup>C timings

All timings apply to 100 kbps (at Standard Mode) , 400 kbps (at Fast Mode) and 3.4 Mbps (at High Speed Mode).


For I<sup>2</sup>C timings, the following abbreviations are used :

S&F Mode = Standard and Fast Mode

Cb = bus capacitance on SDI line

HS Mode = High Speed Mode

All other naming refers to I<sup>2</sup>C specification 2.1 (January 2000).

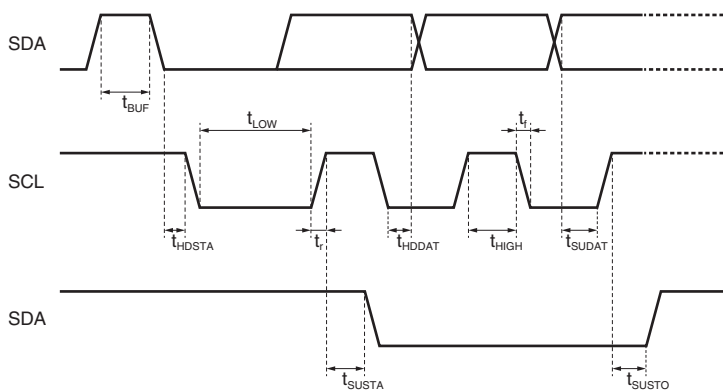

Undescribed items and symbols are compliant with the I<sup>2</sup>C specification.

Items	Symbol	Condition	Min.	Typ.	Max.	Units	Remark
SDI setup time	$t_{SUDAT}$	S&F Mode	160	—	—	ns	
		HS Mode $V_{IO} = 1.62\text{ V}$	30	—	—	ns	
		HS Mode $V_{IO} = 1.2\text{ V}$	55	—	—	ns	
SDI hold time	$t_{HDDAT}$	S&F Mode, $C_b \leq 100\text{ pF}$	80	—	—	ns	
		S&F Mode, $C_b \leq 400\text{ pF}$	90	—	—	ns	
		HS Mode, $C_b \leq 100\text{ pF}$	$V_{IO} = 1.62\text{ V}$	18	—	115	ns
			$V_{IO} = 1.2\text{ V}$	25	—	140	ns
		HS Mode, $C_b \leq 400\text{ pF}$	$V_{IO} = 1.62\text{ V}$	24	—	150	ns
			$V_{IO} = 1.2\text{ V}$	45	—	170	ns
SCK low pulse	$t_{LOW}$	HS Mode, $C_b \leq 100\text{ pF}$	$V_{IO} = 1.62\text{ V}$	160	—	—	ns
			$V_{IO} = 1.2\text{ V}$	210	—	—	ns


(2) SPI timings

All timings are applied both to 4-wire and 3-wire SPI.

To reduce external noise in High-Z state, we recommend the following;

- In 4-wire mode, SDO terminal is pulled up to Vio via the resistor.
- In 3-wire mode, SDI terminal is pulled up to Vio via the resistor.

e.g.) Rpullup = 3.6kΩ @ Vio=1.8V.

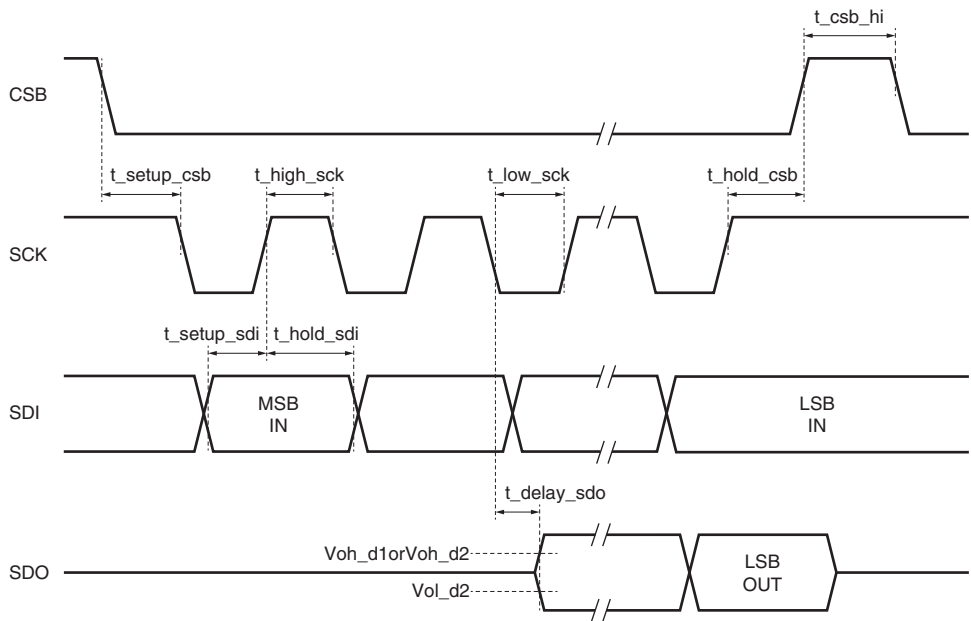

Items	Symbol	Condition	Min.	Typ.	Max.	Units	Remark
SCK frequency	f_spi		—	—	10	MHz	
SCK low pulse	t_low_sck		40	—	—	ns	
SCK high pulse	t_high_sck		40	—	—	ns	
SDI setup time	t_setup_sdi		20	—	—	ns	
SDI hold time	t_hold_sdi		20	—	—	ns	
SDO output delay	t_delay_sdo	Cb = 25 pF, Vio = 1.62 V min	—	—	30	ns	
		Cb = 25 pF, Vio = 1.2 V min	—	—	40	ns	
CSB setup time	t_setup_csb		40	—	—	ns	
CSB hold time	t_hold_csb		40	—	—	ns	
CSB_HI time	t_csb_hi		100	—	—	ns	


Reset Function

The sensor is capable of resetting the operation with “Asynchronous Reset Terminal (RST pin)”.

The procedure is as follows: Input high voltage to RST pin. (100 μs ≥)

Turn off (input low voltage) and wait 10 ms.


Reset sequence

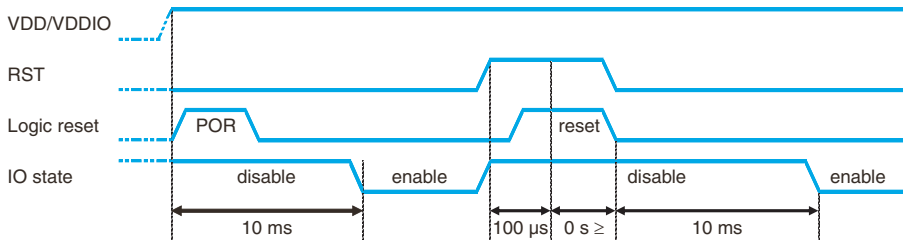


Recommended conditions of communication

In case that this sensor and other sensors are connected with a common bus line, if you use this sensor at a communication speed more than 400 kbit/s, after finishing the communication with other sensors, we recommend to provide 1 ms or more waiting time before starting the communication with this sensor in order to ensure a stable communication (see diagram below).

Typical connection diagram

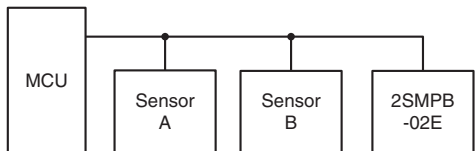

Example of communication

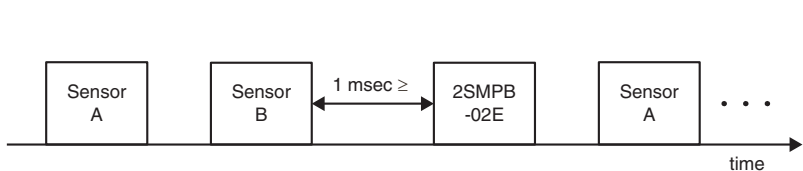



Packaging


■ Configuration of shipment

Packaging	Embossed Carrier Tape
Quantity	3,500 pcs / 1 reel 1 reel / 1 Interior box Max. 20 Interior boxes / 1 exterior box
Reel	180 mm dia.
Insert method	see below


Note: Specification of taping & reel comply with JIS C 0806-3 (IEC 60286-3).

■ Taping


Emboss pitch 4 mm type & tape width 8 mm type.

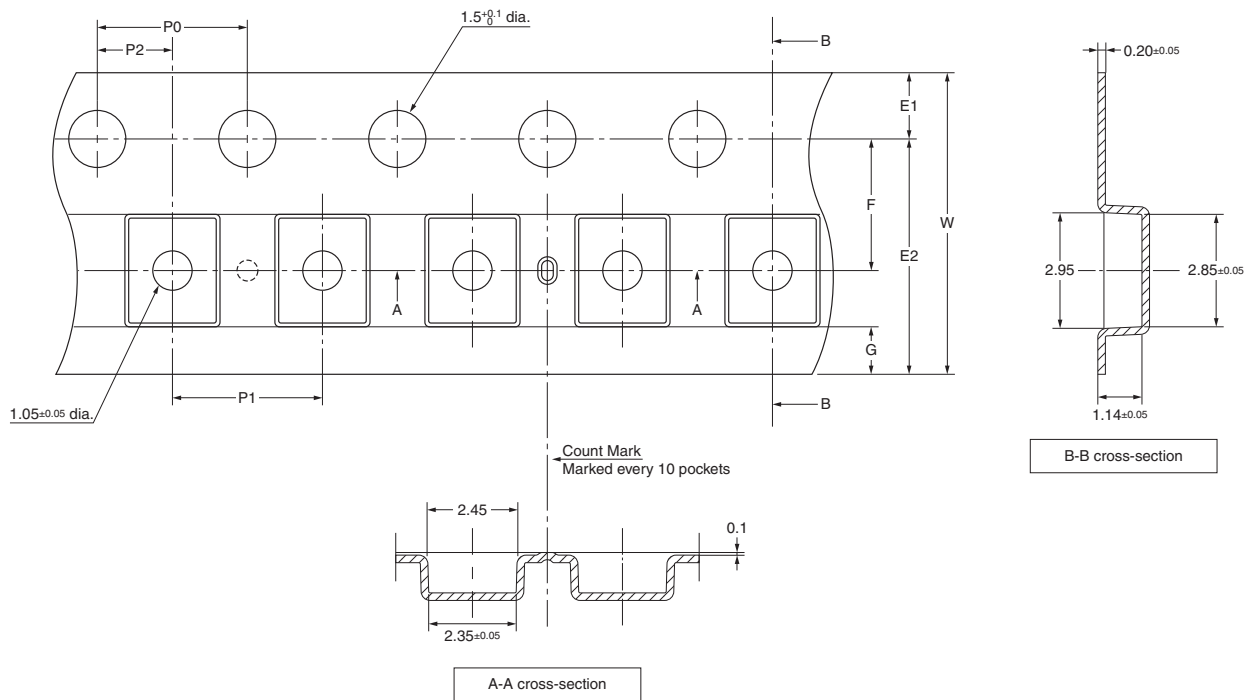


Symbol	Rating
W	8.0 +0.03/-0.1
E1	1.75 +/-0.1
F	3.50 +/-0.05
P0	4.0 +/-0.1
P1	4.0 +/-0.1
P2	2.00 +/-0.05

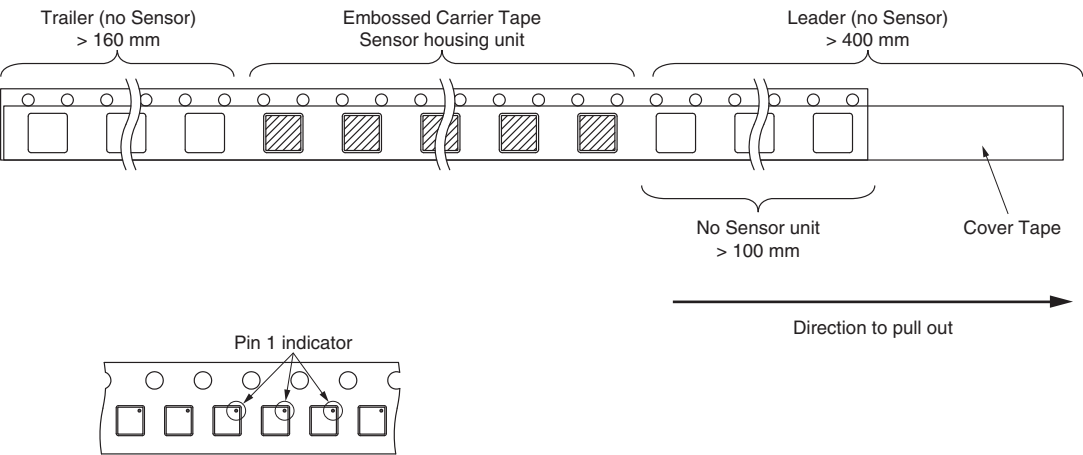

### ■ Reel

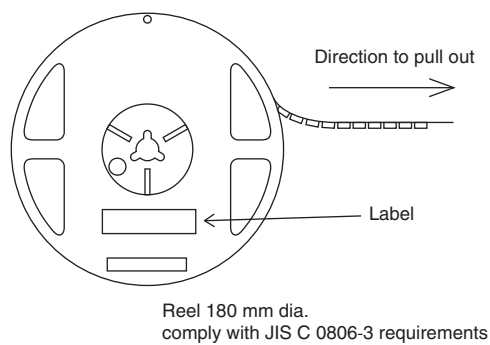

### ■ Individual packaging

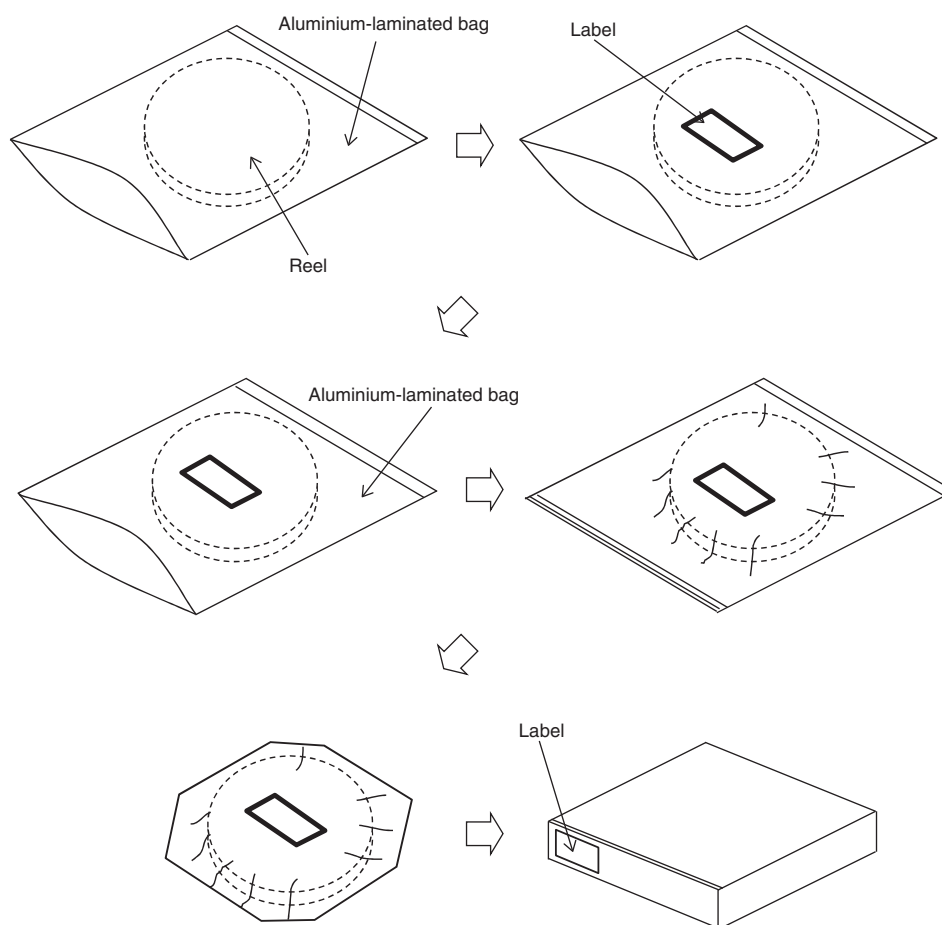

Recommended Soldering Method

■ Soldering method


Air Reflow ( Max. 2 times)

■ Condition of Temperature

Max. 260°C, within 40 seconds

■ Recommended Soldering Method

Temperature profile conditions of reflow soldering should set the temperature condition as shown in the below table and then confirm that actual conditions are met them in the table.

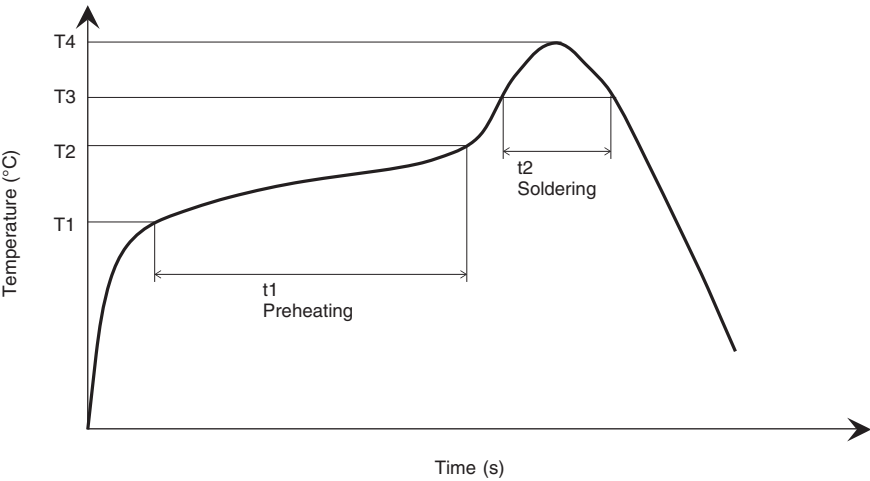

Item	Preheating (T1 to T2, t1)	Soldering (T3, t2)	Peak value (T4)
Terminal	150°C to 200°C 60 sec to 180 sec.	> 217°C 60 sec to 150 sec.	260°C 20 sec to 40 sec.

- Since the pressure sensor chip is exposed to atmosphere, cleaning fluid shall not be allowed to enter inside the sensor's case.
- We recommend that it should be used the recommended mounting PAD dimensions for the land pattern.

## Safety Precautions

### Precautions for Correct Use

#### Handling

- (1) Only air can be used as pressure media on the product directly. It is prohibited to use pressure media including corrosive gases (e.g. organic solvents gases, sulfur dioxide and hydrogen sulfide gases), fluid and any other foreign materials.
- (2) The products are not water proof. The product shall be kept dry in use excluding the sensor port.
- (3) The product shall not be used under dew-condensing conditions. Frozen fluid on sensor chips may cause fluctuation of sensor output and other troubles.
- (4) The product shall be used within rated pressure. Usage at pressure out of the range may cause breakage.
- (5) The product may be damaged by static electricity. Charged materials (e.g. a workbench and a floor) and workers should provide measures against static electricity, including ground connection.
- (6) The product shall not be dropped and handled roughly.
- (7) The product shall not be used under dusty or damp condition.
- (8) Do not wash the print circuit board after the pressure sensor is mounted using solvent. It may cause a mal-function.
- (9) Please connect the sensor terminals according to the connection diagram.
- (10) The product shall not be used under high-frequency vibration including ultrasonic wave.
- (11) This product uses the elastic adhesive for bonding the lid, so do not add excessive stress to the lid.
- (12) If soldering is not fit, then this product may catch fire or get hot.
- (13) There is a possibility that the peripheral circuit board or some electronic part generates heat while driving this product. Please handle with care.
- (14) Do not tear down this product.
- (15) Please do not use the sensor after following case;
  - excessive shock added to the terminal of the sensor
  - the sensor lid decapped
  - the sensor dropped
- (16) If you use other conditions described in this document, please check yourself in advance.

#### Environmental conditions for transport and storage

- (1) The product shall not be kept with corrosive gases (e.g. organic solvents gases, sulfur dioxide and hydrogen sulfide gases).
- (2) The products are not water proof. The product shall be kept dry during storage.
- (3) The outer box strength may be degraded depending on the storage conditions. Please use the product in order.
- (4) For this product, please keep away from direct sunlight or ultraviolet rays.
- (5) The product shall be kept in appropriate conditions of temperature and humidity.
- (6) The product shall not be kept under dusty or damp condition.

## Warranty and Limited Warranty

### Definition

The definition of terms used in these Terms and Conditions are as follows:

- (1) Usage conditions: Usage conditions, rating, performance, operating environment, handling instructions, cautions, prohibited use, etc. of Omron products described in specifications, documentations or manuals.
- (2) Customer application: Application of Omron products by customers which include embedding and/or using Omron products in their parts/components, electronic substrates, devices, equipment or systems manufactured by customers.
- (3) Fitness: (a) performance, (b) non-infringement of third-party intellectual property, (c) compliance with laws and regulations and (d) conformity to various standards.

### Caution on Descriptions

Attention is required to the following points on descriptions in specifications.

- (1) Rated values and performance values are the product of tests performed for separate single conditions, including but not limited to temperature and humidity. It is not intended to warrant rated values and performance values for multiple combined conditions.
- (2) Reference data are provided for reference only. Omron does NOT warrant that Omron products work properly at all time in the range of reference data.
- (3) Application examples are provided for reference only. Omron does NOT warrant the Fitness of Omron products under such application.
- (4) Omron may discontinue the production of Omron products or change the specifications of them for the purpose of improving such products or other reasons entirely at its own discretion.

### Precautions

Please be aware of and accept the following when you introduce or use Omron products:

- (1) Please use Omron products in compliance with usage conditions including rating and performance.
- (2) Please confirm fitness of Omron products in your application and use your own judgment to determine the appropriateness of using them in such application. Omron shall not warrant the fitness of Omron products in customer application.
- (3) Please confirm that Omron products are properly wired and installed for their intended use in your overall system.
- (4) When using Omron products, please make sure to (i) maintain a margin of safety vis-à-vis the published rated and performance values, (ii) design to minimize risks to customer application in case of failure of Omron products, such as introducing redundancy, (iii) introduce system-wide safety measures to notify risks to users, and (iv) conduct regular maintenance on Omron products and customer application.
- (5) Omron products are designed and manufactured as general-purpose products for use in general industrial products. They are not intended to be used in the following applications. If you are using Omron products in the following applications, Omron shall not provide any warranty for such Omron products.
  - (a) Applications with stringent safety requirements, including but not limited to nuclear power control equipment, combustion equipment, aerospace equipment, railway equipment, elevator/lift equipment, amusement park equipment, medical equipment, safety devices and other applications that could cause danger/harm to people's body and life.
  - (b) Applications that require high reliability, including but not limited to supply systems for gas, water and electricity, etc., 24 hour continuous operating systems, financial settlement systems and other applications that handle rights and property.
  - (c) Applications under severe condition or in severe environment, including but not limited to outdoor equipment, equipment exposed to chemical contamination, equipment exposed to electromagnetic interference and equipment exposed to vibration and shocks
  - (d) Applications under conditions and environment not described in specification
- (6) In addition to the applications listed from (a) to (d) above, Omron products are not intended for use in automotive applications (including two wheel vehicles). Please do NOT use Omron products for automotive applications. Please contact Omron sales staff for products for automotive use.

### Warranty Terms and Conditions

The terms and conditions for warranty of Omron products are as follows:

- (1) Warranty period: One year after the purchase.
- (2) Coverage: Omron will provide free replacement of the malfunctioning Omron products with the same number of replacement/alternative products
- (3) Exceptions: Omron will not cover Omron products under its warranty if the cause of the malfunction falls under any of the following.
  - (a) Usage in a manner other than the original intended use for the Omron product.
  - (b) Usage outside of the usage conditions.
  - (c) Cause which could not have been foreseen with the level of science and technology at the time of shipping from Omron.
  - (d) Causes originating from other than Omron or Omron products (including force majeure such as but not limited to natural disasters).

Limitation of Liability

The warranty set out in these Terms and Conditions is the whole and sole liability for Omron products. There are no other warranties, expressed or implied. Omron and the distributors of Omron products are not liable for any damages which may arise from or be related to Omron products.

Export Controls

Customers of Omron products shall comply with all applicable laws and regulations of other relevant countries with regard to security export control, when exporting Omron products and/or technical documents or providing such products and/or documents to a non-resident. Omron may not provide customers with Omron products and/or technical documents should they fail to comply with such laws and regulations.



2SMPB-02E

Please check each region's Terms & Conditions by region website.

OMRON Corporation  
Device & Module Solutions Company

Regional Contact

<b>Americas</b> <a href="https://components.omron.com/us">https://components.omron.com/us</a>	<b>Europe</b> <a href="https://components.omron.com/eu">https://components.omron.com/eu</a>
<b>Asia-Pacific</b> <a href="https://components.omron.com/ap">https://components.omron.com/ap</a>	<b>China</b> <a href="https://components.omron.com.cn">https://components.omron.com.cn</a>
<b>Korea</b> <a href="https://components.omron.com/kr">https://components.omron.com/kr</a>	<b>Japan</b> <a href="https://components.omron.com/jp">https://components.omron.com/jp</a>